



ATTACHING 3-1/4" FULL HT. CORNER POST, IN "T OR X" CONFIGURATION TO FULL HT. CORES

Tools Required:

Socket set with 9/16" socket
9/16" Combination wrench
Philips Screw Driver No. 2 & 3 tips

Hardware Included with PFHFHXC0325-Kit included with Full Ht Corner Column "T" configuration:

8 HHCS, 3/8 -16 x 2-1/4", grade 5
8 Washer, Lock 3/8"
3 Brackets

1. Remove side closure panels (not shown) and upper covers (A), middle ledge panels (J) and removeable bottom panels (K), to gain access for installing hardware.
2. Assembly the lower (B), mid (C) and upper (D) corner brackets to the core as shown with the head of the HHCS (E) and lock washer (F) on the inside of the core upright, through the upright into the corner bracket. At the lower bracket location (B) use the HHCS (G) hardware that comes with the core to attach the corner bracket.
3. Locate level and assemble the second 3 1/4" core to the first one repeating step 1.
4. Locate level and assemble the third 3 1/4" core to the first one repeating step 1.
5. If this is a "T" configuration attach the side cover by inserting the cover tabs at the top, mid and lower locations into the slots (H) on the corner brackets as shown below; if not proceed to step 6.
6. Locate level and assemble the fourth 3 1/4" core, in place of the cover location to the first core one repeating step 1.
7. Reinstall all side closure panels and upper covers (A), middle ledge panels (J) and removeable bottom panels (K).

